Division of Health Service Regulation (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION STATEMENT OF DEFICIENCIES (X3) DATE SURVEY AND PLAN OF CORRECTION IDENTIFICATION NUMBER: COMPLETED A. BUILDING: 01 B. WING HAL081013 07/08/2015 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 704 POORS FORD ROAD OAKLAND LIVING CENTER RUTHERFORDTON, NC 28139 SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION COMPLETE DATE (X4) ID (EACH DEFICIENCY MUST BE PRECEDED BY FULL PREFIX PREFIX (EACH CORRECTIVE ACTION SHOULD BE CROSS-REFERENCED TO THE APPROPRIATE TAG REGULATORY OR LSC IDENTIFYING INFORMATION) TAG DEFICIENCY) C 000 C 000 Initial Comments Report of Biennial Construction Survey by Dennis Harrell on 7-8-2015. CONSTRUCTION SECTION Information gathered from the DHSR Master AUG 3.0 2015 Facility File indicates that this facility was first licensed or submitted 3-4-1998, for a capacity of 40. Based on this information the facility was RECEIVED surveyed for conformance with the 1996 Rules for the Licensing of Adult Care Homes, the applicable portions of the 2005 Rules for Adult Care Homes of Seven or More Beds, and the 1996 North Carolina Building Code for Institutional Unrestrained Occupancies. C 189 C 189 Building Equipment Maintained Safe, Operating SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0311 OTHER REQUIREMENTS (a) The building and all fire safety, electrical, mechanical, and plumbing equipment in an adult care home shall be maintained in a safe and operating condition. (k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities. This Rule is not met as evidenced by: 1. Based on observation the required one-hour fire rated walls and/or ceilings were compromised in several locations. Holes and penetrations that are not sealed with materials approved for use in one-hour fire rated construction and inoperable or missing ceiling radiation dampers present the possibility that a fire that begins in one space can quickly spread to other areas of the facility. Findings include: Residential fire foam used to seal many holes

Division of Health Service Regulation

STATE FORM

LABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE

May Smill

8-5-15

f continuation sheet 1 of 2

Division of Health Service Regulation STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION IDENTIFICATION NUMBER: COMPLETED A. BUILDING: 01 B. WING HAL081013 07/08/2015 STREET ADDRESS, CITY, STATE, ZIP CODE NAME OF PROVIDER OR SUPPLIER 704 POORS FORD ROAD AUG 1 0 2015 OAKLAND LIVING CENTER RUTHERFORDTON, NC 28139 PROVIDERS PLAN OF CORRECTION (EACH CORRECTIVE ACTION SHOULD BE SUMMARY STATEMENT OF DEFICIENCIES (X4) ID ID (X5) COMPLETE (EACH DEFICIENCY MUST BE PRECEDED BY FULL PRÉFIX PREFIX REGULATORY OR LSC IDENTIFYING INFORMATION) CROSS-REFERENCED TO THE APPROPRIATE DATE TAG TAG DEFICIENCY) C 189 | Continued From page 1 C 189 the residential time foam 8-5-15 throughout the facility. Residential type fire foam was Removed and Replaced is not approved for use in Institutional with approved caulking. all escutcheous were checked and fitted to the ceiling Occupancies. b. The sprinkler escutcheon was not tightly fitted to the ceiling complete the one-hour protection in 8-2-15 the bathroom off room 212. the emergency Light was Based on observation, the battery powered Replaced with a New emergency light in the dining room would not 8-2-15 Led light fixture work when tested. Battery powered emergency lights that will not work properly for at least 90 minutes could endanger the residents and staff. was unaware of this 8-2-15 will check the Range hood 8-2-15 when fire extinguisher are checked Based on a review of documents, the range hood was not being inspected monthly as required by NFPA 17A. Faxed to 919-733-6592 8-5-15 9:55PM Michael Sn

IU2M21